

Manhole Inspection Summary

Manhole # S41C__057MH

Printed On: 1/29/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **41C** Node: **057** Status: **Found**

Insp Date: **11/6/08 3:09 PM**

Incomplete Comments

Crew: **dd**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **s. central ave**

Cross Street: **orleans st**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Worn** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☐ Sound ☒ **Cracked** ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **7** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **7** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S41C__057MH


Printed On: 1/29/2009

Page 2 of 3

Location View



Top View

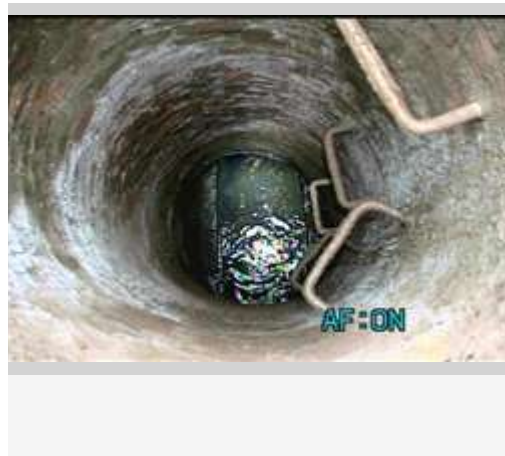

Miscellaneous



worn cover

Defect 3



Frame Cracked

Defect 2



infiltration at barrel wall

Defect 1



chimney deteriorated, corroded steps

Manhole Inspection Summary

Manhole # S41C__057MH

Printed On: 1/29/2009

Page 3 of 3

21 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 15.33 (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 3 (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

21 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 15.10 (ft.) Flow Characteristics: **Fast**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection